




OFFICINE MARIO DORIN SINCE 1918

DORIN[®]
INNOVATION

RICAMBI

SPARE PARTS

CD200

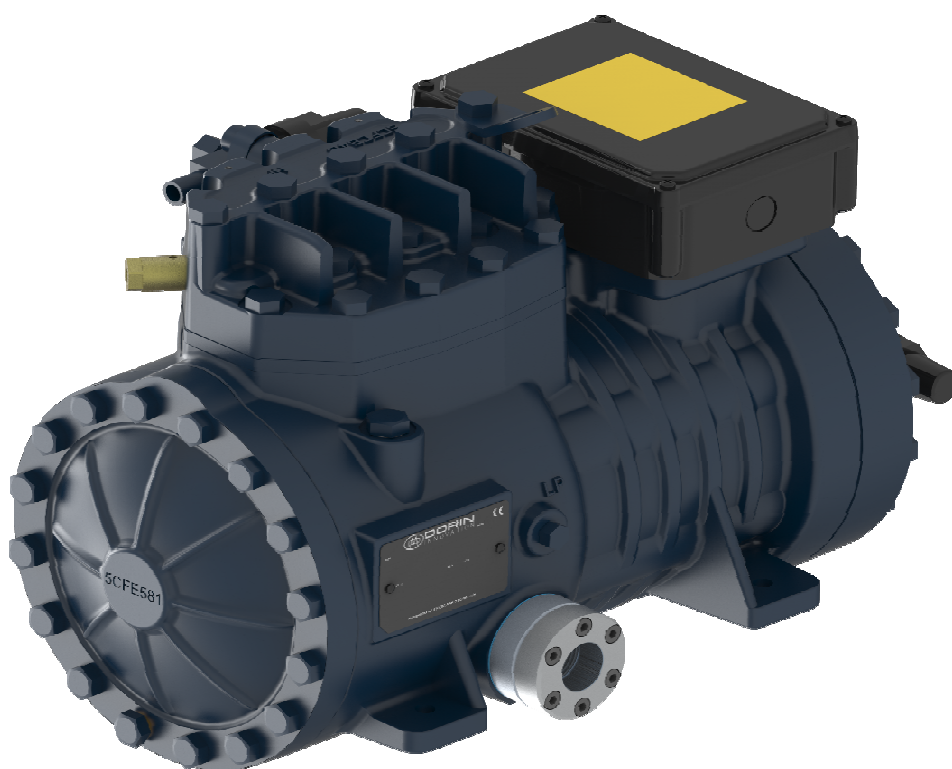


CO₂ SEMI-HERMETIC COMPRESSORS

COMPRESSORI SEMIERMETICI CO₂



OFFICINE MARIO DORIN SINCE 1918
DORIN
INNOVATION

M/COMPRESSORE - M/COMPRESSOR
CD200
MONOSTADIO - SINGLE STAGE

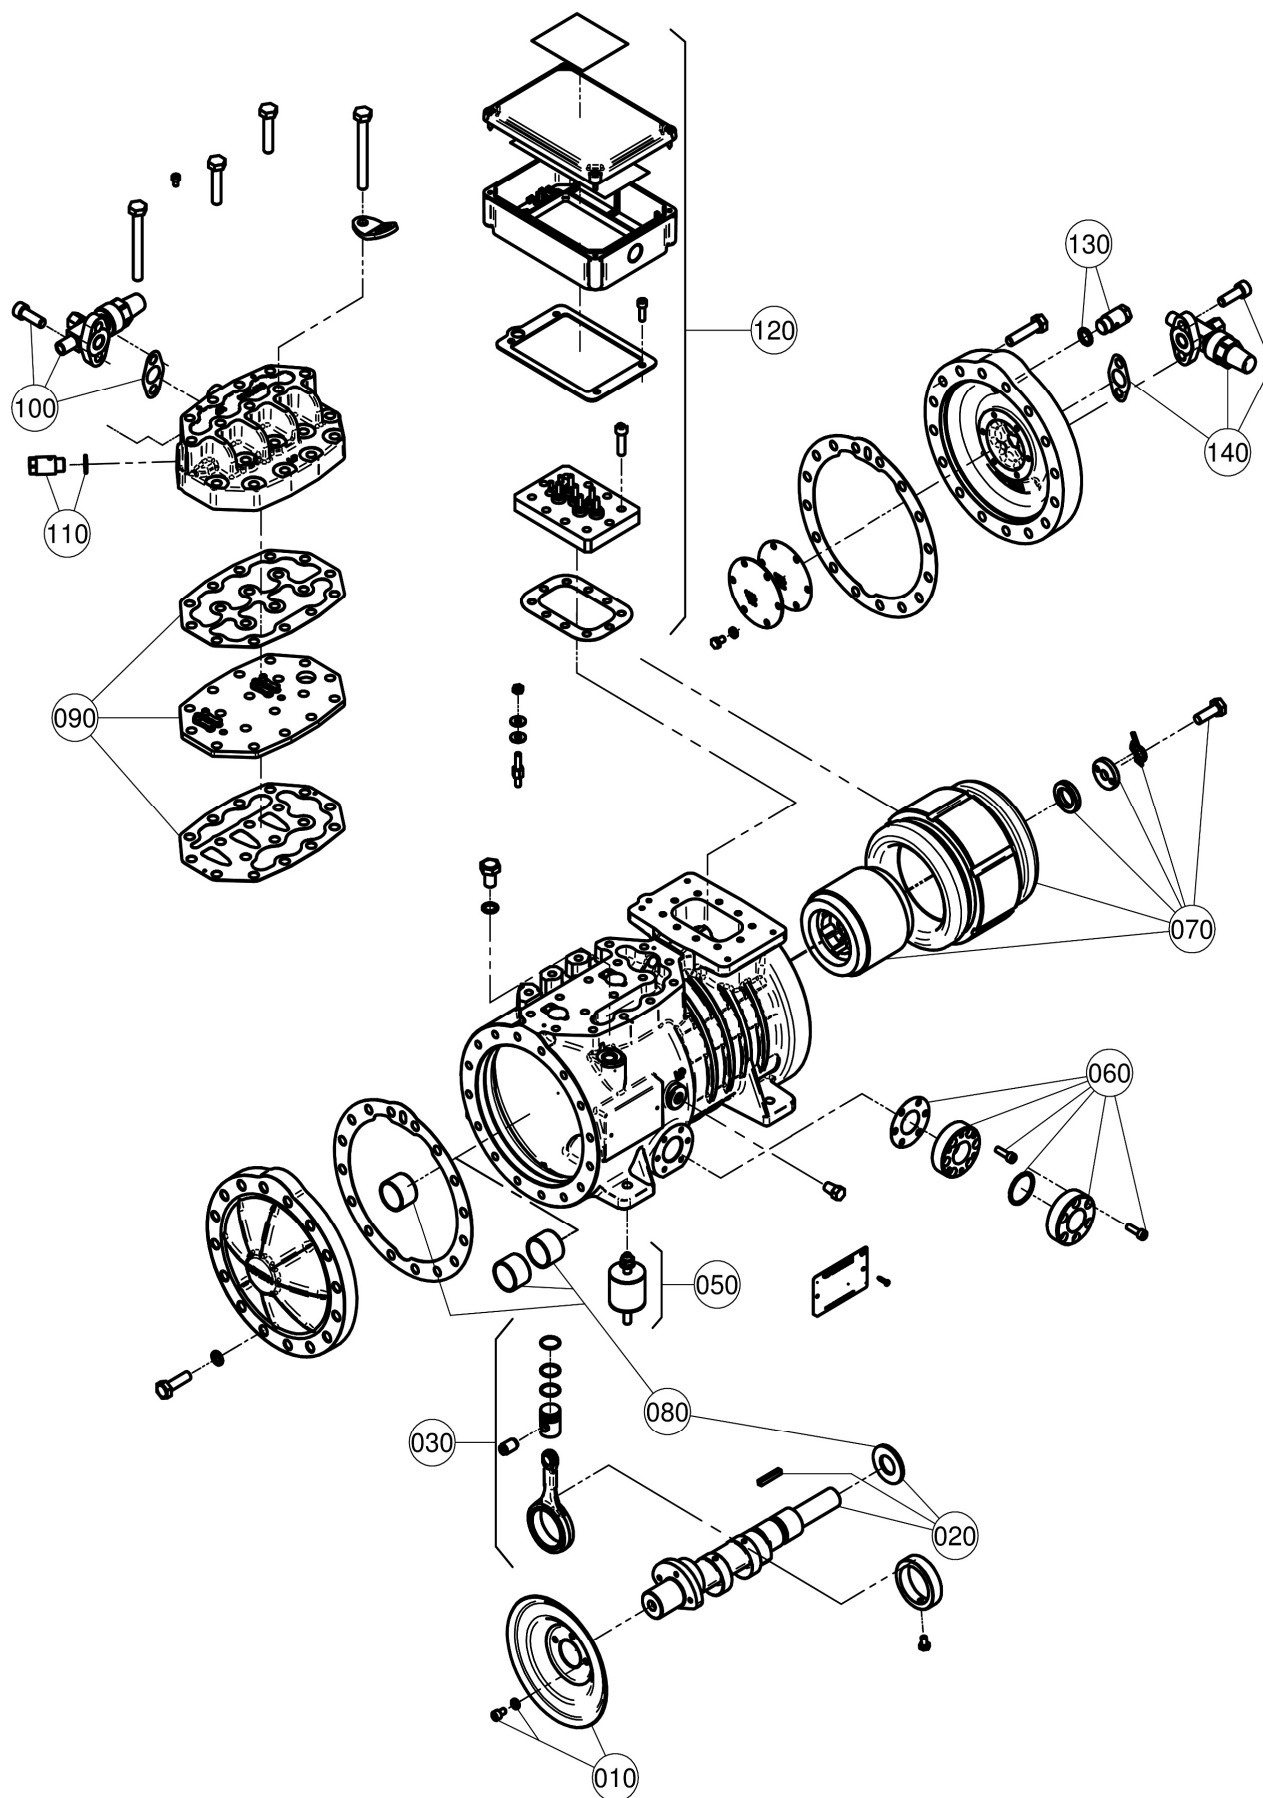



OFFICINE MARIO DORIN SINCE 1918
DORIN
INNOVATION

M/COMPRESSORE - M/COMPRESSOR
CD200
MONOSTADIO - SINGLE STAGE



RIF.	QUANTITA'										CODICE CODE	DESCRIZIONE	DESCRIPTION
	CD150M	CD180H	CD180M	CD300H	CD300M	CD350H	CD350M	CD360H	CD360M	CD380H			
010	1	1	1	1	1	1	1	1	1	1	1MKD053	Disco sbattiolio	Oil centrifugal disk
020	1	1	-	-	-	-	-	-	-	-	1MKA265	Albero completo c.17	Complete shaft c.17
020	-	-	1	1	1	1	-	-	-	-	1MKA266	Albero completo c.22	Complete shaft c.22
020	-	-	-	-	-	-	1	1	1	1	1MKA267	Albero completo c.28	Complete shaft c.28
030	2	2	2	2	-	-	-	-	-	-	1MKM080	Kit biella-pistone D.22 c.17-22	Conn rod.piston compl.D.22 c.17-22
030	-	-	-	-	2	2	2	2	-	-	1MKM081	Kit biella-pistone D.25 c.22	Conn rod.piston compl.D.25 c.22
030	-	-	-	-	-	-	-	-	2	2	1MKM082	Kit biella-pistone D.28 c.28	Conn rod.piston compl.D.28 c.28
050	1	1	1	1	1	1	1	1	1	1	1CC5035	Kit sospensioni compl.	Vibration damper kit complete
060	1	1	1	1	1	1	1	1	1	1	1LKS041	Spia olio completa	Oil sight glass
070	1	-	-	-	-	-	-	-	-	-	1RKK131	Rotostatore 1,5 HP 50Hz	Stator-rotor 1,5 HP 50Hz
070	-	1	1	-	-	-	-	-	-	-	1RKK132	Rotostatore 1,8 HP 50Hz	Stator-rotor 1,8 HP 50Hz
070	-	-	-	1	1	-	-	-	-	-	1RKK133	Rotostatore 3 HP 50Hz	Stator-rotor 3 HP 50Hz
070	-	-	-	-	-	1	-	-	-	-	1RKK134	Rotostatore 3,5 HP 50Hz	Stator-rotor 3,5 HP 50Hz
070	-	-	-	-	-	-	1	-	1	-	1RKK135	Rotostatore 3,6 HP 50Hz	Stator-rotor 3,6 HP 50Hz
070	-	-	-	-	-	-	-	1	-	1	1RKK136	Rotostatore 3,8 HP 50Hz	Stator-rotor 3,8 HP 50Hz
070	1	-	-	-	-	-	-	-	-	-	1RKK180	Rotostatore 1,8 HP 60Hz	Stator-rotor 1,8 HP 60Hz
070	-	1	1	-	-	-	-	-	-	-	1RKK181	Rotostatore 2,1 HP 60Hz	Stator-rotor 2,1 HP 60Hz
070	-	-	-	1	1	-	-	-	-	-	1RKK182	Rotostatore 3,6 HP 60Hz	Stator-rotor 3,6 HP 60Hz
070	-	-	-	-	-	1	-	-	-	-	1RKK183	Rotostatore 4,2 HP 60Hz	Stator-rotor 4,2 HP 60Hz
070	-	-	-	-	-	-	1	-	1	-	1RKK184	Rotostatore 4,3 HP 60Hz	Stator-rotor 4,3HP 60Hz
070	-	-	-	-	-	-	-	1	-	1	1RKK185	Rotostatore 4,6 HP 60Hz	Stator-rotor 4,6 HP 60Hz
080	1	1	1	1	1	1	1	1	1	1	1CKJ522	Kit bronzine + rasamento	Bushing + trust kit
090	1	1	1	1	-	-	-	-	-	-	1PKP130	Piastra valvole completa	Complete valve plate
090	-	-	-	-	1	1	1	1	1	1	1PKP131	Piastra valvole completa	Complete valve plate
100	1	1	1	1	1	1	1	1	1	1	1RKA005	Rubinetto di mandata	Discharge service valve
110	1	1	1	1	1	1	1	1	1	1	1LKV035	Valvola sicurezza alta pressione	Security valve HP
120	1	1	1	1	1	1	1	1	1	1	1RKJ094	Scatola att.el. + piastra	Electrical plate and box
130	1	1	1	1	1	1	1	1	1	1	1LKV034	Valvola sicurezza bassa pressione	Security valve LP
140	1	1	1	1	1	1	1	1	1	1	1RKA005	Rubinetto di aspirazione	Suction service valve
ACCESSORI - ACCESSORIES													
	1	1	1	1	1	1	1	1	1	1	1CCM219	Serie guarnizioni	Complete gasket set
	1	1	1	1	1	1	1	1	1	1	2EG2020	Resistenza carter 220V	Crankcase heater 220V
	1	1	1	1	1	1	1	1	1	1	2EG1050	Resistenza carter 110V	Crankcase heater 110V
	1	1	1	1	1	1	1	1	1	1	2EG1080	Resistenza carter 24V	Crankcase heater 24V
	1	1	1	1	1	1	1	1	1	1	2CC3110	Modulo per termistori	Thermistors module
	1	1	1	1	1	1	1	1	1	1	2CG2050	Sensore livello olio	Oil level sensor



OFFICINE MARIO DORIN SINCE 1918

DORIN[®]
INNOVATION

OFFICINE MARIO DORIN S.p.A.
Via Aretina 388, 50061 Compiobbi - Florence, Italy
Tel. +39 055 62321 1 - Fax +39 055 62321 380

dorin@dorin.com
www.dorin.com